

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-028351**Date Inspected:** 06-Sep-2012**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1700**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site**CWI Name:** As noted below**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** SAS OBG**Summary of Items Observed:**

Quality Assurance Inspector (QA) Douglas Frey was at the American Bridge/Fluor (ABF) job site at Yerba Buena Island in California between the times noted above in order to monitor Quality Control functions and the in process work being performed by ABF personnel. The following items were observed:

**12E PP114.5-BW1 (Interior)**

This QA Inspector randomly observed ABF/JV qualified welder Chris Bowles #9317 perform the Shielded metal Arc Welding (SMAW) process in the 3G vertical position on the beam web located at 12E PP114.5-BW1 on the interior of the OBG. QC Inspector Salvador Merino was observed monitoring the welding on the material the pre-heat and parameters as they pertain to ABF-WPS-D1.5-1040A-Revision 1. The welder was observed drawing 136 amperes with the 3.2mm E7018-H4R electrodes and was noted as cleaning the work between passes utilizing a small disc grinder. This QA Inspector noted that the work at this location is ongoing production work and no issues were noted at the time of the observations. This QA Inspector made subsequent observations throughout the shift to monitor quality and noted that the work was completed on this date and appeared to be in general conformance with the contract specifications.

**12E PP114-PS1 (Interior)**

This QA Inspector randomly observed ABF/JV qualified welder Deli Zhang #4735 perform the SMAW process in the 3G vertical position on the plate stiffeners located at 12E PP114-PS1 on the interior of the OBG. QC Inspector Salvador Merino was observed monitoring the welding on the material the pre-heat and parameters as

---

## WELDING INSPECTION REPORT

( Continued Page 2 of 3 )

---

they pertain to ABF-WPS-D1.5-1040A-Revision 1. The welder was observed drawing 135 amperes with the 3.2mm E7018-H4R electrodes and was noted as cleaning the work between passes utilizing a small disc grinder. The welder completed face "A" of the work and back-gouged from the root side of the weld. QC performed an MT test and inspection of the joint and found no relevant indications. This QA Inspector observed the welder begin work on face "B" of the plate. This QA Inspector made subsequent observations throughout the shift to monitor quality and noted that the work was in progress and appeared to be in general conformance with the contract specifications.

### 12E PP112.5-PS3 (Interior)

This QA Inspector randomly observed ABF/JV qualified welder Jose Torres #6235 perform the SMAW process in the 2G horizontal position on the plate stiffener located at 12E PP112.5-PS3 on the interior of the OBG. QC Inspector Salvador Merino was observed monitoring the welding on the material the pre-heat and parameters as they pertain to ABF-WPS-D1.5-1040A-Revision 1. The welder was observed drawing 136 amperes with the 3.2mm E7018-H4R electrodes and was noted as cleaning the work between passes utilizing a small disc grinder. The welder completed face "A" of the work and back-gouged from the root side of the weld. QC performed an MT test and inspection of the joint and found no relevant indications. This QA Inspector observed the welder begin work on face "B" of the plate. This QA Inspector made subsequent observations throughout the shift to monitor quality and noted that the work was in progress and appeared to be in general conformance with the contract specifications.

### 12E PP111.1 (Exterior)

This QA Inspector randomly observed the excavation operations of Ultrasonic rejectable indications on the Complete Joint Penetration (CJP) joint at 12E PP111.1 on the exterior of the OBG. This QA Inspector observed ABF/JV qualified welder Wai Kit Lai #2953 performing the Carbon Arc Gouging (CAG) method to remove metal from the material. The welder was observed cleaning up the excavations utilizing a small disc grinder and a de-burring drill. Upon completion of the excavation, Quality Control (QC) Inspector Salvador Merino performed a Magnetic Particle Inspection (MT) of the sites to determine soundness of the metal and observed no indications, QC then measured the dimensions of the excavations for length, width and depth. This QA Inspector recorded the dimensions of the excavations as:

Y=60mm: 330mm in length, 30mm wide and 10mm deep, y=640mm; 60mm in length, 20mm wide and 5mm deep, y=865mm; 50mm in length, 20mm wide and 6mm deep, y=1240mm; 50mm in length, 20mm wide and 7mm deep, y=1440mm; 80mm in length, 30mm wide and 13mm deep, y=1880mm; 125mm in length, 40mm wide and 10mm deep, 1970mm; 60mm in length, 20mm wide and 10mm deep.

Prior to welding, QC Inspector Salvador Merino was observed monitoring and measuring the pre-heat temperatures and parameters as they pertain to ABF-WPS-D1.5-1004-Repair-Revision 0. This QA Inspector made random observations of SMAW in the 3G vertical position and noted no issues with the work at this location and no RWR was required for this first time weld repair. This QA Inspector made subsequent observations throughout the shift to monitor quality and it was noted that the E7018-H4R electrodes were stored properly in a sealed container after being opened and they were drawing amperage of 136. The welder was observed continuing the in process repair welding and this QA Inspector noted that no issues were present at this location. QC Inspector

---

## WELDING INSPECTION REPORT


( Continued Page 3 of 3 )

---

Salvador Merino was also present to monitor the welding and the parameters in the later stages of the shift. This QA Inspector noted that the work at this location was completed on this date and appeared to be in general conformance with the contract specifications.

### Summary of Conversations:

Discussed testing requirements for completed welds with Quality Control Inspector Salvador Merino.

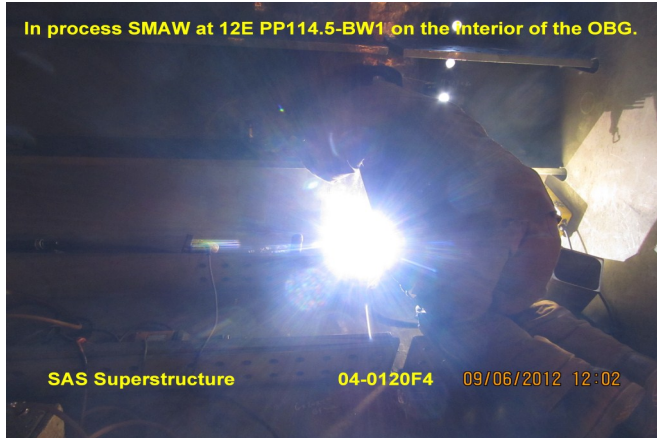

### Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Gary Thomas 916-764-6027 , who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Frey,Doug	Quality Assurance Inspector
<b>Reviewed By:</b>	Levell,Bill	QA Reviewer

---